



Failure analysis of an aircraft APU exhaust duct flange due to low cycle fatigue at high temperatures

Gyu-ho Kim^{a,*}, Bok-won Lee^b, Hongbing Lu^a, Jong-hyun Park^c

^a Department of Mechanical Engineering, The University of Texas at Dallas, Richardson, TX 75080, USA

^b Aero-Technology Research Institute, R.O. Korea Airforce, Dae-gu 701-799, South Korea

^c CNF Co., Ltd., Jeon-buk 561-844, South Korea

ARTICLE INFO

Article history:

Received 12 January 2011

Received in revised form 31 October 2011

Accepted 7 November 2011

Available online 16 November 2011

Keywords:

Auxiliary power unit (APU)

Creep damage

Low cycle fatigue

Thermal stress

ABSTRACT

Considerable crack-like-defects were observed in an auxiliary power unit (APU) exhaust duct flange area in a jet aircraft with 900 cumulative flying hours. A detailed investigation of crack-induced fracture surface was conducted using Scanning Electron Microscopy (SEM) and computer aided thermal-stress analysis. The results showed that failure of the flange occurred due to the combined effects of the flange constraint and the cyclic thermal stress of the duct. The failure analysis in this study calls for the need for improvement in structure design and installation method of the APU duct system in order to reduce the damage resulting from the creep and fatigue crack during the early stages of service.

© 2011 Elsevier Ltd. All rights reserved.

1. Introduction

An auxiliary power unit (APU) in a vehicle is a device that performs various functions except for propulsion [1]. Different types of APUs are found in aircrafts, as well as in large ground vehicles. The primary purpose of an aircraft APU is to provide power to start the main engines. A typical gas turbine APU in an aircraft consists of a jet fuel starter and an emergency power unit.

APU has a power section to generate gas and produce all the power for the shaft. It also has a duct system to guide and deliver airflow. APU exhaust duct is the final section of a duct system that allows the gas to exit the aircraft. APU exhaust duct is usually attached to the aircraft skin structure through a flange. The duct and flange are connected through brazing during manufacturing. During operation, an APU system is exposed to periodic heating environment.

A considerable amount of crack damage has been observed around the APU exhaust duct flange area in a jet aircraft after 900 cumulative flying hours. In an aircraft, the structural components and major mechanical systems have to meet the design requirements of the overall durability or design service life over several thousands of flying hours. A number of critical parts such as main engine components are subject to periodic inspections and maintenance to ensure functional integrity. The APU exhaust duct component, however, has not been categorized as a primary group that requires a periodic maintenance plan.

In this paper, visual inspection, analysis of fractograph, and finite element analysis have been conducted for failure analysis of the crack damaged APU. It shows that cyclic thermal stress as well as excessive mechanical constraints has contributed to the formation of fatigue cracks in the flange. It is anticipated that this study would provide confirmation of the necessity for the improvements in the design for APU.

* Corresponding author. Tel.: +1 972 883 4647.

E-mail address: gyuho.kim@utdallas.edu (G.-h. Kim).

2. Investigation details

Visual observation of the crack-damaged area identified the crack length, its initiation location and propagation path as well as any surface topography features. Subsequently, that section was cut to expose the damaged surface induced by cracks. The fractograph was acquired using a Scanning-Electron Microscopy (SEM: Hitachi SU-70) with analytical energy-dispersive X-ray spectrometer (EDS) to further analyze and find the crack initiation location, its propagation pathway, damage types and/or overall failure characteristics. Thermal-stress analysis was conducted on the crack-damaged area to determine whether any environmental effects (heat) played a role. The overall features of the APU exhaust duct are shown in Fig. 1. APU exhaust duct has a flange, which was attached to the upper part of the fuselage structure. It has a circular type and includes guided outlet vanes that assist the gas to exit the aircraft. The figure shows cracks and damage in the flange.

3. Results and discussion

3.1. Visual inspection

Visual inspection of the damaged duct reveals cracks and chafing sites around the duct flange and its fillet as shown in Fig. 2. Two major cracks exist along the duct flange fillet as shown in Fig. 2A. The crack lengths are approximately 13 cm and 10 cm. In addition, there is considerable chafing developed on the flange (Fig. 2B), and the chafing sites are very close to crack sites.

The existence of chafing reveals that there is an extensive wear by friction between contacted surfaces of flange and the corresponding structure. Then the duct and flange were cut away to find the brazing state and its quality as shown in Fig. 2C. Brazing is a typical process for joining metals using a filler metal [2]. A careful observation of the brazing area was performed to find any defects from structures or associated filler metal. It shows that there is no considerable defect on the brazing joint and manufacturing quality of brazing may not have any connection with this failure.

A closer visual inspection of duct and lower surface of flange shows that there is a considerable discoloration around the crack as shown in Fig. 3A. The discoloration of metallic surface usually means that the part has been exposed to high temperature condition. The APU gas flows through the duct for exit and the temperature of gas reaches up to 600 °C when fully developed. Another observation is that there is a distributed trace of scratch on the lower surface of flange as shown in Fig. 3B. It has been reported from manufacturers that those scratches can be made possible during the removal process of beads that were created during brazing work. Overall visual inspection of the damaged duct shows that cracks, heat, and chafing may have an effect on the failure of APU exhaust duct.

3.2. Fracture surface inspection

Fig. 4 shows fracture surface of flange created by the crack. Visual observation of fracture surface shows that the surface is mainly divided into two parts by different crack propagation. The entire area of the upper part is much bigger than that of the lower part. In addition, a ratchet mark appears. Ratchet marks usually occur on a surface where high stress concentration is present [3]. It also means that the crack has been initiated from multiple origins [4,5]. Many crack initiation sites were found under a closer observation.

A more detailed fracture surface investigation has been conducted using the Scanning Electron Microscopy (SEM). There are creeps on the flange upper surface and fatigue crack propagations (striations) on the fracture surface as shown in Fig. 5. Creep is a slow deformation phenomenon under stress condition in solid materials below yield strength [6]. Creep damage is

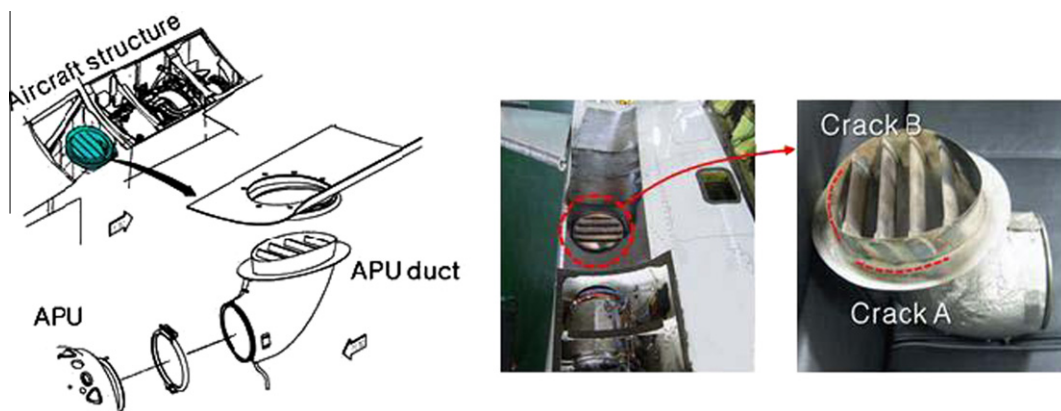


Fig. 1. Overall features of the APU exhaust duct.

Download English Version:

<https://daneshyari.com/en/article/769867>

Download Persian Version:

<https://daneshyari.com/article/769867>

[Daneshyari.com](https://daneshyari.com)