

Available online at www.sciencedirect.com

ScienceDirect

journal homepage: http://www.elsevier.com/locate/pjnns



Case report

Delayed perforation of posterior pharyngeal wall caused by dislodged bioresorbable interbody cage. Case report

Krzysztof Zapałowicz ^{a,*}, Maciej Radek ^a, Maciej Wojdyn ^a, Piotr Pietkiewicz ^b, Jurek Olszewski ^b

^a Department of Neurosurgery and Peripheral Nerve Surgery, Medical University of Łódź, University Hospital WAM-CSW, Łódź, Poland ^b Department of Otolaryngology and Laryngological Oncology, Medical University of Łódź, University Hospital WAM-CSW, Łódź, Poland

ARTICLE INFO

Article history: Received 10 June 2013 Accepted 16 December 2013 Available online 23 January 2014

Keywords:
Anterior cervical fusion
Cervical interbody cage
Biomaterials
Pharyngeal perforation
Complication

ABSTRACT

A 48-year-old man was admitted for the management of congenital anomalies: Arnold–Chiari type I malformation combined with odontoid upward migration. He also had degenerative stenosis of the spinal canal by spurs at C2/C3 and C3/C4 levels. Osseous deformities caused ischaemic changes of the brainstem as well as spinal cord compression. Authors used the Biocage – interbody cage covered by bioresorbable layer to fill the surgically created gap after removal of the right part of C3 vertebral body. Twenty-seven months after implantation, the implant was extruded through posterior pharyngeal wall. Authors describe this unusual case and discuss possible causes of Biocage extrusion.

© 2014 Polish Neurological Society. Published by Elsevier Urban & Partner Sp. z o.o. All rights reserved.

1. Introduction

Historically, the first methods of anterior decompression of the cervical spinal cord used bone grafts as the material for interbody fusion [1,2]. As an alternative way, implantation of cages made of metals or synthetic materials has been proposed instead of bone grafts [1–4]. Bioresorbable implants made of lactic acid polymer were introduced in 1966 to stabilize long-bone fractures, and later were adapted to spinal surgery [3]. Their inherent properties entail gradual resorbtion in physiological milieu [3–6] and elastic modulus more similar to the bone than that of titanium or nonresorbable polymers

[5,6]. The cervical bioresorbable cage – Biocage (Cousin Biotech) is tubular in shape, and slightly bent to imitate cervical lordosis [7]. The wall of the tube is radiolucent, made of polyester mesh tissue, and impregnated with solution of polyL-lactic acid (PLLA). The elasticity of both materials reduces the stress-shielding effect. To enable X-ray detection, the longitudinal radiopaque fibre is inserted into the wall [7]. After implantation, the PLLA is gradually resorbed, permitting bone penetration into perforations of the polyester wall [7]. Söderlund et al. implanted Biocage combined with anterior screw-plate system in seventeen patients. After a mean follow-up of thirty months, he concluded that fusion was complete in five cases and probable in ten others, whereas in

^{*} Corresponding author at: Klinika Neurochirurgii i Chirurgii Nerwów Obwodowych, Uniwersytetu Medycznego w Łodzi, Uniwersytecki Szpital Kliniczny im. WAM-CSW, ul. Żeromskiego 113, 90-549 Łódź, Poland.

E-mail address: krzysztofzapalowicz1@wp.pl (K. Zapałowicz).

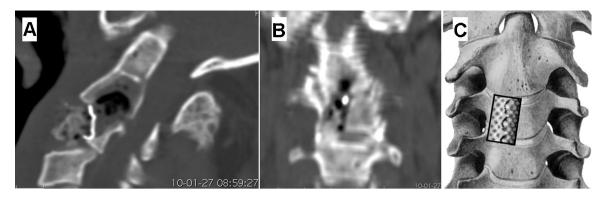


Fig. 1 – CT of the cervical spine performed two days after Biocage implantation. Sagittal (A) and frontal (B) image reconstructions, with schematic drawing (C), demonstrating the position of Biocage (note the presence of radiopaque fibre).

two cases the implant did not fuse [7]. Based on encouraging results published by Söderlund et al., we used the Biocage to fill the surgically created gap in the right part of C3 vertebral body. Twenty-seven months after implantation, the Biocage was extruded through posterior pharyngeal wall. We describe this unusual case and discuss possible causes of Biocage extrusion.

2. Case report

A 48-year-old man was admitted for management of Arnold-Chiari type I malformation combined with odontoid upward migration. He also had spinal cord compression by spurs at C2/ C3 and C3/C4 levels. Osseous deformities caused ischaemic changes of the brainstem as well as spinal cord compression. According to Nurick scale, the patient's neurological status was assessed as grade IV. He underwent consecutive operations: (1) in July 2009 and in October 2010, subtotal odontoidectomies by transpharyngeal approach - during both procedures total removal of the odontoid peg was not successful due to important bleeding; (2) in January 2010, discectomies of C2/C3 and C3/C4 with removal of the right part of the C3 vertebral body, followed by C2-C4 spondylodesis with Biocage (Fig. 1); (3) in May 2010, decompression of the posterior fossa with C1-C4 laminectomies followed by stabilization between occiput and C7. Computed tomography (CT) examinations (April and October 2010) revealed stability of the Biocage (Fig. 2). The patient was reviewed at follow-up examinations demonstrating improvement to Nurick grade

III. In May 2012, he arrived declaring that an odd-looking object had expelled through his mouth during severe cough after two days of dysphagia - in fact it turned out to be a Biocage (Fig. 3). There was no history of trauma or fever. Oropharyngeal examination revealed wound of the posterior pharyngeal wall measuring 1 cm \times 2 cm, situated beneath the cicatrised incision used for odontoidectomy (Fig. 4). Complementary investigations showed 4200 leukocytes per mm³. Computed tomography disclosed absence of the Biocage in the place of implantation (Fig. 5). Treatment was started by intravenous antibiotics (amoxycillin plus clavulanic acid and metronidazole). The following day the wound was sutured by an otolaryngologic surgeon. The patient was fed by nasogastric tube for nine days. Despite there being no suppuration, the antibiotherapy was continued, combined with Octenidine oral gargles. He was discharged after healing of the wound. Otolaryngologic followup revealed cicatrisation of the posterior pharyngeal wall.

3. Discussion

In order to elucidate the possible cause of Biocage migration, we tried to analyze if this complication might arise from surgical error or other factors. Regarding the surgery, the Biocage was fit to the size of surgically created space between C2 and C4 and tightly placed in its interior. Lack of complementary anterior instrumentation does not explain delayed lack of fusion. Reinforcement of the Biocage by anterior screw-plate system was planned; however, intraoperatively it was ruled out due to

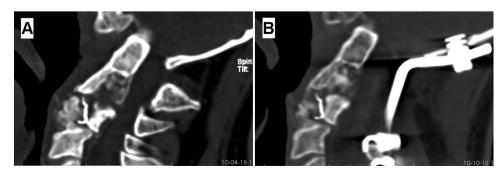


Fig. 2 – Control CT images performed three months (A) and nine months (B) after implantation. There are no signs of Biocage displacement.

Download English Version:

https://daneshyari.com/en/article/2152725

Download Persian Version:

https://daneshyari.com/article/2152725

Daneshyari.com