

Available online at www.sciencedirect.com

ScienceDirect

journal homepage: www.elsevier.com/locate/ihj

Case Report

Removal of the broken part of implantable cardioverter-defibrillator's electrode causing pulmonary embolism via femoral vein



Cemil Zencir ^{a,*}, Mithat Selvi ^a, Huseyin Elbi ^b, Mustafa Cetin ^c,
Hasan Gungor ^a, Cagdas Akgullu ^a, Muharrem Ismail Badak ^d

^a Adnan Menderes University, School of Medicine, Department of Cardiology, Turkey

^b Celal Bayar University, School of Medicine, Department of Family Medicine, Turkey

^c Adiyaman University, School of Medicine, Department of Cardiology, Turkey

^d Adnan Menderes University, School of Medicine, Department of Cardiovascular Surgery, Turkey

ARTICLE INFO

Article history:

Received 26 February 2015

Accepted 4 June 2015

Available online 22 December 2015

Keywords:

Infective endocarditis

Electrode

Pulmonary embolism

ABSTRACT

A 66-year-old patient with idiopathic dilated cardiomyopathy underwent transvenous extraction of an implantable cardioverter-defibrillator. The distal part of the electrode was broken during manual traction through the left subclavian vein. In the present case, we showed a rare complication of transvenous lead extraction and its management.

© 2015 Cardiological Society of India. Published by Elsevier B.V. All rights reserved.

1. Introduction

With the growing number of recently published studies, the number of cardiac pacemaker implantations has also dramatically increased.^{1–3} This increase has also been related with higher rate of device-related infections (0.8–5.7%) and so necessitates its removal.⁴ Treatment of infective endocarditis includes extraction of the device and initiation of relevant antibiotics.⁵ According to various case series, extraction of pacemaker electrodes is related with various complications, including myocardial and vascular injuries, acute pericardial tamponade, hemothorax, and tricuspid valve injury.^{6,7}

Pulmonary embolism of the lead or broken part of lead materials is so rare. In this case report, we present an implantable cardioverter-defibrillator (ICD) extraction process and management of pulmonary lead embolism.

2. Case report

>A 66-year-old woman, who has an ICD implanted anterior to the left pectoral muscle by left subclavian vein entry-site approach on May 2012 with active fixation, was consulted to our clinic because of high fever and changes of mental status while preparing preoperatively for prolapsed uterine in the

* Corresponding author at: Adnan Menderes University, School of Medicine, Department of Cardiology, 09000, Aydin, Turkey. Tel.: +90 555 2786521; fax: +90 256 2144086.

E-mail address: drczencir@hotmail.com (C. Zencir).

0019-4832/\$ – see front matter © 2015 Cardiological Society of India. Published by Elsevier B.V. All rights reserved.

<http://dx.doi.org/10.1016/j.ihj.2015.06.004>

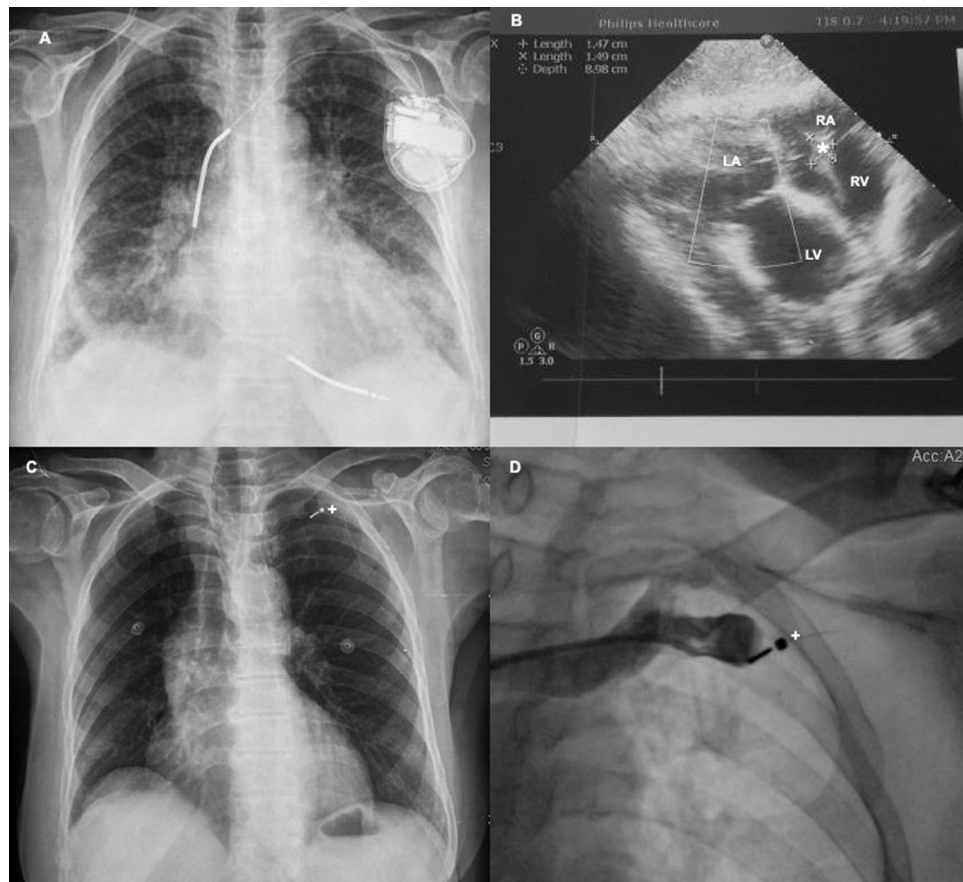


Fig. 1 – Chest X-ray image in the usual ICD (A), echocardiographic image of vegetation on the electrode (B), chest X-ray image in the regular electrode fragment (C), and left subclavian venography preventing passage opaque appearance as electrode fragment (D). RA, right atrium; RV, right ventricle; LA, the left atrium; LV, left ventricle; *, vegetation with thrombus; +, an electrode fragment.

obstetrics and gynecology clinic. As viewed by the chest X-ray, placement of ICD and electrode was normal (Fig. 1A). On the transthoracic echocardiography (TTE), there was endocarditis vegetation with dimensions of 1.5 cm × 2 cm on electrocatheter leads, especially in the level of the tricuspid valve (Fig. 1B). Subsequently, the patient was taken to intensive care unit with a diagnosis of infective endocarditis. Antibiotherapy was started. During the follow-up period, blood cultures were taken; however, there were no reproductions of microorganisms. After a week, there was no improvement in clinical situation of patient, and vegetation size did not change on TTE. Therefore, the patient underwent the transvenous extraction of whole system. Lead body dwelling time is 21 months. Currently, three different techniques have been used for electrode extraction: surgical extraction, percutaneous extraction by a superior approach, or percutaneous extraction by an inferior approach. Percutaneous extraction by superior approach procedure was performed with fluoroscopy in the catheterization laboratory. First, ICD battery was extracted. However, the distal part of the electrode was broken during manual traction through the left subclavian vein. Distal broken electrode fragment was left in the subclavian vein (Fig. 1C). Left subclavian venography revealed a broken electrode fragment

and thrombus formation, which was placed in the mid-subclavian vein (Fig. 1D, Video 1). Then, it was decided to extract the broken electrode fragment through the femoral approach. The broken electrode fragment was captured in subclavian vein with 25 mm snare (Amplatzer GooseNeck Snare, Covidien Co, MN, USA). The captured electrode fragment was embolized to the left pulmonary artery at the level of the right atrium (Fig. 2A). Pulmonary angiography showed embolized electrode fragment in branches of the left pulmonary artery and was captured once again by the help of the snare (Fig. 2B, Video 2). While the electrode fragment was pulling back at the level of the main pulmonary artery, it was fled to the right branch of pulmonary artery over again (Fig. 2C, Video 3). The broken electrode fragment was captured again with the snare in the right branch of pulmonary artery and was drawn up to the femoral vein. It was pulled to the right femoral vein. The fragment was greater than sheath diameter, and to avoid dissecting the scar tissue about the lead, it was removed by exploration of the femoral vein; afterwards, femoral vein was closed by cardiovascular surgery using primary suture with local anesthesia in the operating room. The broken electrode fragment was removed successfully and there were no residual fragments (Fig. 2D).

Download English Version:

<https://daneshyari.com/en/article/2927651>

Download Persian Version:

<https://daneshyari.com/article/2927651>

[Daneshyari.com](https://daneshyari.com)